S7A V 8.50

Version History

© 2022 INCOSOL - Jürgen Stähler INCOSOL - Jürgen Stähler

1. '	What is new in V 8.50, build 104	5
2.	What is new in V 8.50, build 102	7
2.1	Support for iFIX 2022 (6.8)	8
2.2	Re-arranged grid columns on TIA symbol grid	
3. '	What is new in V 8.50, build 101	9
3.1	New Setup	10
3.2	Support for iFIX secure mode introcuced with iFIX version 6.5	10
3.3	Support for CIMPLICITY HMI versions 9.5 up to 11.5 (2022)	11
3.4	Symbol Editor with watch feature	11
3.5	OPC UA Server	12
3.6	Automatic iFIX block generation of TIA symbols	14
3.7	Extended data block diagnosis and client access monitoring	15
4.	Fixed defects in V 8.50, build 104	17
4.1	Program installation (Setup)	18
4.2	Power_Tool	18
4.3	Native iFIX interface	18
4.4	Native CIMPLICITY interface	19
5.	Fixed defects in V 8.50, build 102	21
5.1	Offset addressing via iFIX DR block on analog TIA symbols	22
5.2	High CPU load caused by S7ADRV process	22
5.3	Power Tool failed to connect to background process	22
6.	Fixed defects in V 8.50, build 101	23
6.1	Lower case I/O addresses or OPC Item Ids	24
6.2	Import of version 8.10 CSV import files	24
6.3	Poll overrun counting	24
6.4	Fragmented polling on demand	24
6.5	Limitation of Slot number range	24
6.6	iFIX Register Element Offset	24
6.7	Control Tag addresses for symbolic (TIA) driver objects	25
6.8	Simulation mode	25
6.9	OPC UA Security Policy	25
6.10	Limitation of Cimplicity point name length	25
6.11	Software license and lower case computer name	25
7.	Known Issues	27

Index 0




1 What is new in V 8.50, build 104

This topic and its sub-topics briefly describes all new features added to S7A version 8.50, build 104

The build 104 does not contain new main features but the following minor changes/improvements and some bug fixes (see topic Fixed defects in V 8.50, build 104 18).

Minor changes and improvements:

• When the S7A Power Tool is started while another instance of the program is already running, the following message box will be displayed:

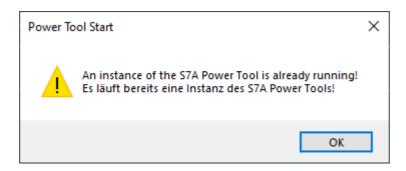

Since at this stage the specific language information is not yet available the message is displayed in English and German language.



2 What is new in V 8.50, build 102

This topic and its sub-topics briefly describes all new features added to S7A version 8.50, build 102

The build 102 does not contain new main features but the following minor changes/improvements and some bug fixes (see topic Fixed defects in V 8.50, build 102^{22}).

Minor changes and improvements:


- Support for <u>iFIX 2022</u> 8 (6.8)
- Re-arranged grid columns 8 in TIA symbol grid.

2.1 Support for iFIX 2022 (6.8)

The S7A driver now supports the new iFIX version 2022 respectively 6.8 in both modes, means with or without access controls.

2.2 Re-arranged grid columns on TIA symbol grid

The columns of the TIA symbol grid have been re-arranged / re-sorted. Furthermore the two left-most columns 'Symbol' and 'Selected' are now 'pinned', means they are anchored to the left side of the grid. When the grid is scrolled horizontally these two columns will not be scrolled.

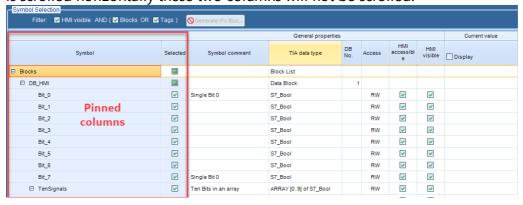




3 What is new in V 8.50, build 101

This topic and its sub-topics briefly describes all new features added to S7A version 8.50, build 101

The main new features are:

- New setup 10 routine
- Support for <u>iFIX secure mode</u> 10 introcuced with iFIX version 6.5
- Support for <u>CIMPLICITY HMI</u> 11 versions 9.5 up to 11.5 (2022)
- OPC UA Server 12
- <u>Symbol editor</u> [11] for all communication ways with physical (classic) addressing
- iFIX <u>block generation</u> 14 from TIA symbolic
- Extended data block diagnosis and client access monitoring 15

3.1 New Setup

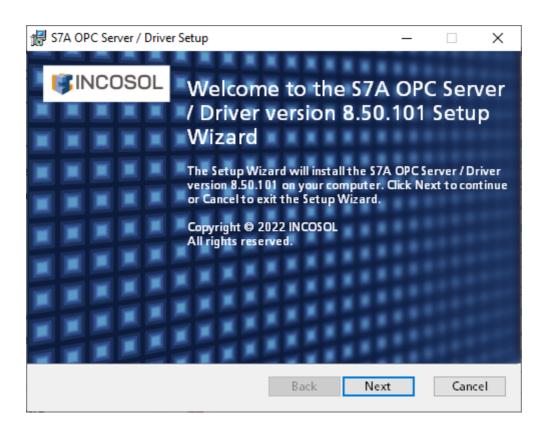

The Setup of the S7A OPC Server has to be redesigned to address the additional requirements for the OPC UA Server installation.

3.2 Support for iFIX secure mode introcuced with iFIX version 6.5

In iFIX version 6.5 GE introduced a new secure mode which even has influence on the S7A driver.

One aspect of this secure mode is that all iFIX processes (SCU, Workspace, WSACTask etc.) now runs with a reduced so-called Integrity Level *Medium*. on all former iFIX versions the program run on Integrity Level *High*.

For proper interoperability between the S7A driver and iFIX it was necessary to adapt/downgrade the integrity level of the S7A process (S7ADrv.exe) to the same *Medium* level as iFIX works on.


3.3 Support for CIMPLICITY HMI versions 9.5 up to 11.5 (2022)

The S7A driver now supports all CIMPLICITY HMI versions from 9.5 up to latest version 11.5, also know as CIMPLICITY 2022.

The native CIMPLICITY driver interface has been fully refactored with the goal of improving the performance and usability.

Now all control tags the S7A driver provides can be access by CIMPLICITY points. Furthermore all signal conditioning functions and options, the S7A driver provides, can be used in CIMPLICITY. E.g. S7 data and time data types now can be configured as CIMPLICITY text points in various, language specific display formats.

3.4 Symbol Editor with watch feature

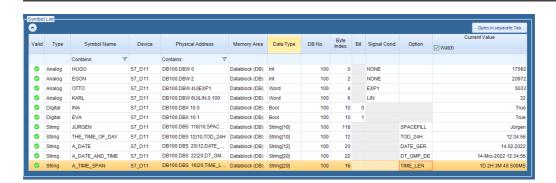


The driver now allows to define symbols for I/O addresses of communication ways with physical addressing (e.g. S7 300/400/1500 TCP Absolute). These symbols can be used as iFIX I/O addresses or OPC Item Ids as an alternative to the physical I/O address. Means, a symbolic name and I/O address are interchangeable.

Furthermore the symbolic names configured by the Symbol Editor are the node base for the OPC UA server.

As an additional feature the Symbol Editor provides a watch function which allows to facilitate the monitoring of the current value online from the PLC.


3.5 OPC UA Server

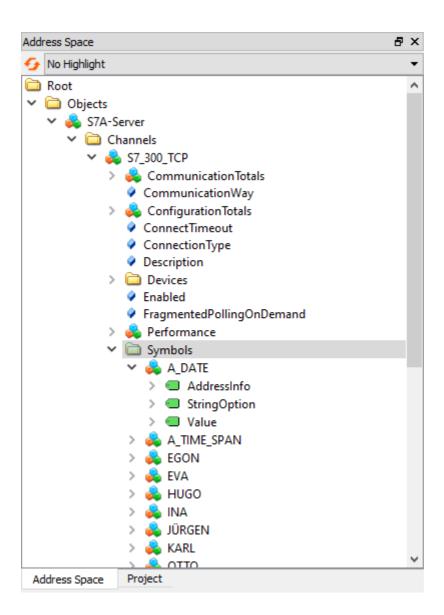

The S7A driver is now a full functioning OPC UA Server. This functionality is not available in the base license but a license option.


All physical communication ways (via symbol editor) as well as the two symbolic communication ways for S7-1200/1500 series and SIMOTION controllers can provide its data as OPC UA nodes.

Furthermore most of the driver's, channel's, device's and data block's configuration, runtime, performance and diagnostics properties are browsable and readable from OPC UA clients.

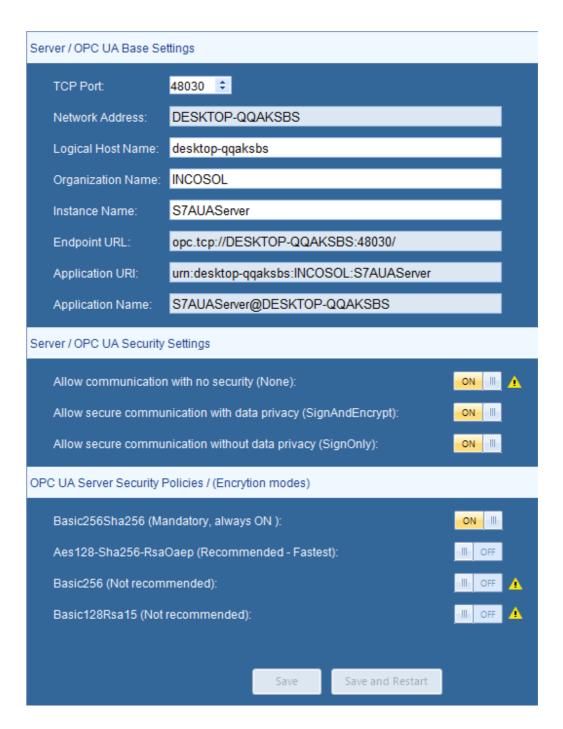


The configuration of the OPC UA Server and the entire certificate management (even the request from a GDS) is integrated in the S7A Power Tool.

3.6 Automatic iFIX block generation of TIA symbols

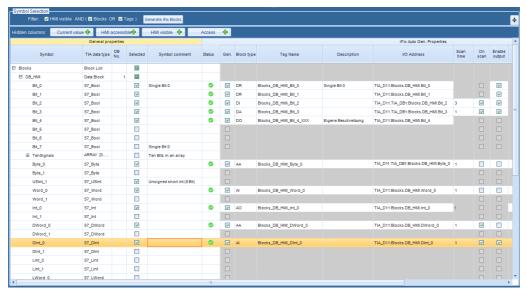


The symbol selection tree in the Power Tool's TIA data block configuration dialog has been extended by addition columns which allows to directly configure and generate iFIX database blocks from within the Power Tool. The following data block fields can be configured by this way:

- Block Types DI, DA, DO, DR, AI, AA, AO, AR and TX
- *Tag Name* can be generated automatically, derived from the TIA symbol path or can be entered individually
- Tag Description can be generated automatically, derived from the TIA symbol comment or can be entered individually
- I/O Address, derived from S7A device name and TIA symbol path
- Startup mode On Scan or Off Scan
- Scan Time
- Enable Output Option
- Signal Conditioning
- Hardware Option
- EGU Low Limit and High Limit

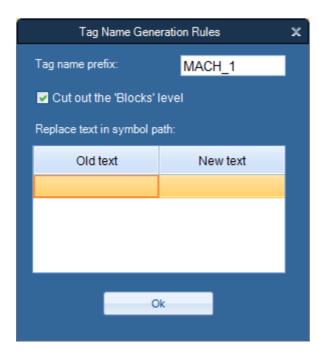

The automatic iFIX tag name generation can be controlled by various options.

3.7 Extended data block diagnosis and client access monitoring

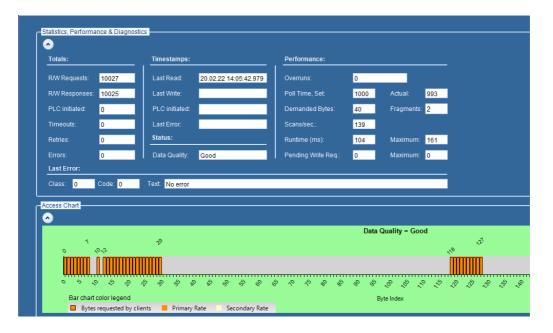

The Power Tool now provides a tool which allows the monitoring of the client access to the data byte of a single driver data block.

A bar chart, shown on the new expandable panel 'Access Chart' in the Power Tool's data block dialog visualizes the access state of all bytes of the data block with different colors and thus provides a direct view of the current 'occupancy' of the data block by the clients (iFIX, OPC etc.).




4 Fixed defects in V 8.50, build 104

The following topics describe all defects which have been fixed in build 104.

4.1 Program installation (Setup)

The 'Account' field in the 'Service Logon Credentials' dialog did not accept hyphens (dashes). Now hyphens within the account name are allowed.

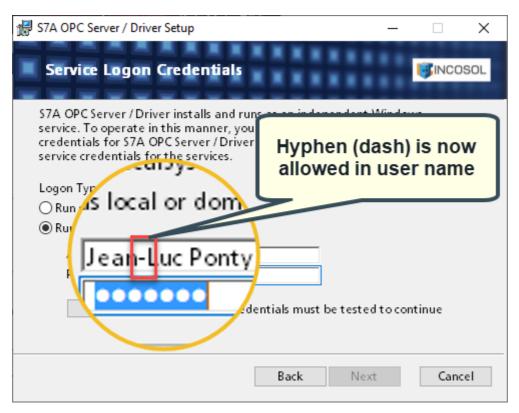

4.2 Power_Tool

- 1. In the device configuration dialog of a S7 TCP channel the selection of the PLC type has not been persistently stored. Instead it has been reset to the default selection 'S7-300/400' once the configuration dialog has been closed and opened again.
- 2. For data blocks with memory area unequal to 'Data Block' the start index could not be set to a value greater than zero.

4.3 Native iFIX interface

- 1. When the data block option 'Auto Create' was activated the S7A background process (S7ADrv) could possibly crash when the iFIX data base manager program was launched.
- 2. A memory leakage in the S7A background process (S7ADrv), the iFIX WSACTask and the iFIX data base manager might occur in cases where the iFIX data base contained blocks with unresolved S7A I/O addresses.

4.4 Native CIMPLICITY interface

- 1. The native CIMPLICITY driver process S7A_DC.EXE possibly could crash.
- 2. Writing a value to a single element of a CIMPLICITY Array point failed.



5 Fixed defects in V 8.50, build 102

The following topics describe all defects which have been fixed in build 102.

5.1 Offset addressing via iFIX DR block on analog TIA symbols

The indexed addressing (F_x) via iFIX DR block of a bit within an analog TIA symbol value failed. Only the first bit's value was read no matter which offset was defined in the iFIX data link.

5.2 High CPU load caused by S7ADRV process

On large S7A configuration with multiple symbolic TIA channels and devices the S7A driver background process S7ADrv.exe could cause a high CPU load of more than 50%.

5.3 Power Tool failed to connect to background process

After the driver was installed as a service the S7A Power Tool and all other clients which run on integrity level 'Medium' failed to connect to the background process (S7ADrv.exe service). After a restart of the computer or a restart of the S7A Driver service the issue disappeared.



6 Fixed defects in V 8.50, build 101

The following topics describe all defects which have been fixed in build 101.

6.1 Lower case I/O addresses or OPC Item Ids

The I/O address portion (the part right to the colon) of an iFIX I/O address or an OPC Item Id now accept lower case characters for the memory area and data type specifier. Example: 'D11:db100.dbw0' now is a valid I/O address.

6.2 Import of version 8.10 CSV import files

- The import of a CSV configuration file exported by version 81.0 failed due to an invalid or missing symbol filter expression string value (CSV file property TCPTIASymbolFilterExpr) in the channel portion of a symbolic TIA channel.
- The import of a CSV configuration file exported by version 81.0 failed due to an invalid or missing TIA project file time stamp value (CSV file property TCPTIAProjectTSSaved) in the channel portion of a symbolic TIA channel. The driver now tolerates such missing property values.
- CSV import failed when the CSV file was modified and save in MS Excel. Now the driver accepts CSV files which were modified and saved by Excel.
- The Channel property **TCPMaxGap** has been added to achieve compatibility with CSV files generated with version 8.10.

6.3 Poll overrun counting

The detection of the polling overruns counted much more overruns than actually occurred.

6.4 Fragmented polling on demand

The 'S7-300/400/1500 TCP/IP Absolute' communication way channel feature 'Fragmented polling on demand' now works properly.

6.5 Limitation of Slot number range

The **Slot** number field in the TCP/IP device settings dialog was limited to a range between 0 and 10. The upper limit has been extended to 64.

6.6 iFIX Register Element Offset

The **iFIX Register Offset is Element Offset** channel setting failed in S7A 8.50 RC14. This option is working properly now.

6.7 Control Tag addresses for symbolic (TIA) driver objects

All control tag addresses (e.g. !Mode:<device name>) with driver objects (Channel, Device or Data Block) of symbolic communication ways (TIA and SIMOTION) failed and were rejected by the S7ADrv.

6.8 Simulation mode

In simulation mode of symbolic communication ways (TIA and SIMOTION) the data quality 'BAD' was returned to the clients (iFIX or OPC). Now the driver returns the proper data quality 'GOOD'.

6.9 OPC UA Security Policy

 
Setting the OPC UA Security Policy 'None' on or off via the Power Tool's OPC UA options dialog had no effect on the OPC UA Server.

6.10 Limitation of Cimplicity point name length

The length of a CIMPLICITY point address was limited to 32 characters, which is too less for symbolic addresses for TIA or SIMOTION communication ways. The address length has been extended to 296 characters.

6.11 Software license and lower case computer name

Under certain circumstances the comparison of the computer name against the name encoded in the software license file failed when the computer name contained lower case characters.



7 Known Issues

The following issues or functional restrictions are still pending and are going to be address by the next version or build.

- The TCP port number of the EDA GRPC server is not configurable. Currently it is solely changeable in the S7ADIDW.exe.config file.
- The EDA GRPC Server's log files are stored in the installation folder but not in the program data path (where the other S7A program store their log files).
- The change of the user interface language does not work when S7A is installed as a service and Power Tool is started with integrity level 'Medium'.